

S1C17 Family C Compiler Package Ver.3.0.x

S5U1C17001C

Release History and Issues

Evaluation board/kit and Development tool important notice

1. This evaluation board/kit or development tool is designed for use for engineering evaluation, demonstration, or development purposes only. Do not use it for other purposes. It is not intended to meet the requirements of design for finished products.
2. This evaluation board/kit or development tool is intended for use by an electronics engineer and is not a consumer product. The user should use it properly and in a safe manner. Seiko Epson does not assume any responsibility or liability of any kind of damage and/or fire caused by the use of it. The user should cease to use it when any abnormal issue occurs even during proper and safe use.
3. The part used for this evaluation board/kit or development tool may be changed without any notice.

NOTICE

No part of this material may be reproduced or duplicated in any form or by any means without the written permission of Seiko Epson. Seiko Epson reserves the right to make changes to this material without notice. Seiko Epson does not assume any liability of any kind arising out of any inaccuracies contained in this material or due to its application or use in any product or circuit and, further, there is no representation that this material is applicable to products requiring high level reliability, such as, medical products. Moreover, no license to any intellectual property rights is granted by implication or otherwise, and there is no representation or warranty that anything made in accordance with this material will be free from any patent or copyright infringement of a third party. When exporting the products or technology described in this material, you should comply with the applicable export control laws and regulations and follow the procedures required by such laws and regulations. You are requested not to use, to resell, to export and/or to otherwise dispose of the products (and any technical information furnished, if any) for the development and/or manufacture of weapon of mass destruction or for other military purposes.

All brands or product names mentioned herein are trademarks and/or registered trademarks of their respective companies.

Table of Contents

1. Release History	2
GNU17 3.0.5: Oct. 30, 2015	2
GNU17 3.0.4 (GNU17 3.0): May. 27, 2015	3
GNU17 3.0.3 (GNU17 3.0 Beta2): Apl. 27, 2015	4
GNU17 3.0.2 (GNU17 3.0 Beta): Apl. 03, 2015	5
GNU17 3.0.1 (GNU17 3.0 Alpha2): Feb. 28, 2015	6
GNU17 3.0.0 (GNU17 3.0 Alpha): Jan. 30, 2015	7
2. Known Issues	8
2.1 IDE	8
2.2 C Compiler	8
2.3 Library	9
2.4 Assembler	9
2.5 Linker	9
2.6 Debugger	9
2.7 ICD driver	9
2.8 Other Tools	9
Revision History	10

1. Release History

1. Release History

GNU17 3.0.5: Oct. 30, 2015

	Changes	Issues	Resolved Issues
IDE	<ul style="list-style-type: none">• Wizard to create "GNU17 Debug Configuration" was defined.• Creation of PA file was changed to the last step of the post build process, because it is not able to create PA file for the program on RAM.• A dummy g++ (calls xgcc) was prepared for the environment checker of IDE. It is not a C++ compiler.• Making "inc" folder and setting it to the include path were added when the project was made newly.• The parameter of the c17 model command of debugger command file "gdb*.ini" follows to the change of Target CPU.• The parameter of the c17 model_path command of debugger command file "gdb*.ini" follows to the GNU17 installation folder.• The problem of outputting ROM data different from the size specification of some MCUs was solved.• EmbSysRegView plug-in was installed.• Failures detected by in-house test are corrected.	IDE-009	IDE-004 IDE-005 IDE-006
C Compiler	<ul style="list-style-type: none">• The definition of "stdarg.h" was changed to pass the arguments of struct, long long, double and etc. to the function taking variable number of arguments.• Failures detected by in-house test are corrected.	GCC-002 GCC-003	GCC-004
Library	<ul style="list-style-type: none">• crt0.o, libc.a and libg.a were re-build.• Failures detected by in-house test are corrected.	LIB-002 LIB-003	
Assembler	<ul style="list-style-type: none">• None		
Linker	<ul style="list-style-type: none">• *.o files containing no program code became linkable.• The issue that the linker sometimes fails in the main function linkage at O2 or more optimization level was corrected.• Failures detected by in-house test are corrected.		
Debugger	<ul style="list-style-type: none">• break and tbreak commands were changed to use hardware breakpoints, if it is possible.• Failures detected by in-house test are corrected.	GDB-002 GDB-004	
ICD Driver	<ul style="list-style-type: none">• The ICD driver was signed.		
Other Tools	<ul style="list-style-type: none">• Installation processing was changed so that all users on installed PC might use GNU17.• The method of WinMDC's checking the size of input ROM data was changed.• New sample projects were added.• C17 MCU model-specific information was updated.		

GNU17 3.0.4 (GNU17 3.0): May. 27, 2015

	Changes	Issues	Resolved Issues
IDE	<ul style="list-style-type: none"> Project type to create libraries is supported. 	IDE-004 IDE-005 IDE-006	IDE-001 IDE-002 IDE-003 IDE-007 IDE-008
C Compiler	<ul style="list-style-type: none"> Failures detected by in-house test are corrected. 	GCC-002 GCC-003 GCC-004	GCC-001
Library	<ul style="list-style-type: none"> crt0 is available with gcc3. libg.a was implemented again to ignore compiler optimizations. limits.h was updated because of UINT_MAX, USHORT_MAX, LONG_MAX and SHRT_MIN definitions. GCC4 Emulation library and ANSI library were built with GCC4. 	LIB-002 LIB-003	LIB-001
Assembler	<ul style="list-style-type: none"> Failures detected by in-house test are corrected. 		GAS-001
Linker	<ul style="list-style-type: none"> Removing unnecessary "ext" instructions is supported. 		GLD-001
Debugger	<ul style="list-style-type: none"> None 	GDB-002 GDB-004	GDB-001
ICD Driver	<ul style="list-style-type: none"> None 		DRV-001
Other Tools	<ul style="list-style-type: none"> None 		ETC-001

1. Release History

GNU17 3.0.3 (GNU17 3.0 Beta2): Apl. 27, 2015

	Changes	Issues	Resolved Issues
IDE	<ul style="list-style-type: none">Failures detected by in-house test are corrected.	IDE-001 IDE-004 IDE-005 IDE-006 IDE-007 IDE-008	IDE-002 IDE-003
C Compiler	<ul style="list-style-type: none">Failures detected by in-house test are corrected.	GCC-001 GCC-002	
Library	<ul style="list-style-type: none">Symbol names defined by libg.a are changed to WRITE_FLASH and WRITE_BUF.Entries for gcc4 are appended to libgcc.a.	LIB-001 LIB-002	
Assembler	<ul style="list-style-type: none">None	GAS-001	
Linker	<ul style="list-style-type: none">Default linker script is updated.	GLD-001	
Debugger	<ul style="list-style-type: none">Failures detected by in-house test are corrected..	GDB-001 GDB-002 GDB-004	
ICD Driver	<ul style="list-style-type: none">None	DRV-001	
Other Tools	<ul style="list-style-type: none">None	ETC-001	

GNU17 3.0.2 (GNU17 3.0 Beta): Apl. 03, 2015

	Changes	Issues	Resolved Issues
IDE	<ul style="list-style-type: none"> • Generating new GNU17 V3 project is available. • Importing GNU17 V2 project is available. • Setting GNU17 project properties is available. 	IDE-001 IDE-002 IDE-003	
C Compiler	<ul style="list-style-type: none"> • Failures detected by in-house test are corrected.. • Generating delayed branch instructions are supported. 	GCC-001	
Library	<ul style="list-style-type: none"> • The following libraries were re-compiled. <ul style="list-style-type: none"> • libg.a 	LIB-001	
Assembler	<ul style="list-style-type: none"> • None 	GAS-001	
Linker	<ul style="list-style-type: none"> • Default linker script is updated. 	GLD-001	
Debugger	<ul style="list-style-type: none"> • Failures detected by in-house test are corrected.. 	GDB-001 GDB-002 GDB-004	
ICD Driver	<ul style="list-style-type: none"> • None 	DRV-001	
Other Tools	<ul style="list-style-type: none"> • The following tools were added. <ul style="list-style-type: none"> • moto2ff.exe • sconv32.exe 	ETC-001	

1. Release History

GNU17 3.0.1 (GNU17 3.0 Alpha2): Feb. 28, 2015

	Changes	Issues	Resolved Issues
IDE	<ul style="list-style-type: none">None	IDE-001	
C Compiler	<ul style="list-style-type: none">Failures detected by in-house test are corrected..	GCC-001	
Library	<ul style="list-style-type: none">The following libraries were re-compiled.<ul style="list-style-type: none">crt0.olibg.a	LIB-001	
Assembler	<ul style="list-style-type: none">None	GAS-001	
Linker	<ul style="list-style-type: none">None	GLD-001	
Debugger	<ul style="list-style-type: none">Debugging the target system using the ICDmini3 is available.	GDB-001 GDB-002	GDB-003
ICD Driver	<ul style="list-style-type: none">None	DRV-001	
Other Tools	<ul style="list-style-type: none">None	ETC-001	

GNU17 3.0.0 (GNU17 3.0 Alpha): Jan. 30, 2015

	Changes	Issues
IDE	<ul style="list-style-type: none"> The version of Eclipse was changed from 3.4.0 to 4.4.1. The plug-in for GNU17 2.x was deleted. 	IDE-001
C Compiler	<ul style="list-style-type: none"> The version of GCC was changed from 3.3.2 to 4.9.1. The following command line options were deleted. <ul style="list-style-type: none"> -mshort-offset -mno-sjis-filt 	GCC-001
Library	<ul style="list-style-type: none"> The following libraries were added. <ul style="list-style-type: none"> crt0.o libg.a 	LIB-001
Assembler	<ul style="list-style-type: none"> The version of binutils was changed from 2.10.1 to 2.24. The following command line options were deleted. <ul style="list-style-type: none"> -mc17_ext 	GAS-001
Linker	<ul style="list-style-type: none"> The version of binutils was changed from 2.10.1 to 2.24. The following command line options were deleted. <ul style="list-style-type: none"> -c17-overlap-noerr -c17-memoryover-noerr 	GLD-001
Debugger	<ul style="list-style-type: none"> The version of gdb was changed from 5.1.1 to 7.8. The following command line options were added. <ul style="list-style-type: none"> --model --model_path The following command line options were deleted. <ul style="list-style-type: none"> --c17-cmw --c17-double_starting Commands corresponding to new comand line options were added. Icdmini3 was added to Type of the target command for the ICDmini3 support. Some GNU17 original commands were deleted. 	GDB-001 GDB-002
ICD Driver	<ul style="list-style-type: none"> ICDmini3 was supported. 	DRV-001
Other Tools	<ul style="list-style-type: none"> The version of binutils was changed from 2.10.1 to 2.24. The following tools were deleted. <ul style="list-style-type: none"> make.exe ccap.exe moto2ff.exe sconv32.exe LCDUtil17 Insight 	ETC-001

2. Known Issues

2. Known Issues

2.1 IDE

IDE-009 When "GCC Version" is changed on "GNU17 Setting" page of the project property, don't see "C/C++ Build / Settings" page until the property dialog is closed.

IDE-008 When "Target CPU" and "Memory Model" was changed on "GNU17 Setting" page of the project property, it is necessary to build, clean and build the project again.

IDE-007 When "GCC Version" was changed on "GNU17 Setting" page of the project property, it is necessary to restart Eclipse. (Including new gcc3 project, because gcc4 is default setting.)

IDE-006 If "Debug configuration" of the project has been removed, it is necessary to set parameters of new "Debug configuration" manually.

IDE-005 In case of the program located on the RAM, its builder reports an error at creating the PA file.

IDE-004 The Problem window shows a message: Program ""g++"" not found in PATH.

IDE-003 Project should be set manually when [GCC Version] (C compiler) 3.3 is selected.

- Copy sample linker script "sample/sample_gcc3/elf32c17.x" to the project folder.
- Adjust the project's [C/C++Build] > [Settings] > [Tool Settings] properties as followings:
 - Change [Cross Settings] > [Path] setting to "C:\EPSON\GNU17V3\gcc3".
 - Add following libraries to [Cross GCC Linker] > [Libraries] > [Libraries (-l)].
 - c
 - stdio
 - gcc\${GCC17_COPRO}

Add "-T ..\elf32c17.x" to [Cross GCC Linker] > [Miscellaneous] > [Other options].

IDE-002 Installation destination folder should be C:\EPSON\GNU17V3.

IDE-001 The test is not completed.

2.2 C Compiler

GCC-004 The compiler may output unexpected results when "struct" "long long" "double" type arguments are passed to a variable arguments function. Please confirm the function acts appropriately by the output program.

GCC-003 How to pass arguments of some types is different in GCC4 and GCC3. Please re-build the existing program from sources through GCC4.

GCC-002 When calling a function which has double or long long type arguments, The way to pass those arguments is different from the manual.

GCC-001 The test is not completed.

2.3 Library

LIB-003 GCC4 uses the existing libraries developed for GCC3.

LIB-002 Corresponding to the compiler issue GCC-002, functions replacing arguments are included in the emulation library.

LIB-001 The test is not completed.

2.4 Assembler

GAS-001 The test is not completed.

2.5 Linker

GLD-001 The test is not completed.

2.6 Debugger

GDB-004 Results of commands on GDB console may not be reflected in the GUI.

GDB-003 Debugging the target system using the ICDmini3 from the IDE is not available.

GDB-002 ICD33/ICDmini 1.0/1.1/2.0 are not supported.

GDB-001 The test is not completed.

2.7 ICD driver

DRV-001 The test is not completed.

2.8 Other Tools

ETC-001 The test is not completed.

Revision History

Revision History

Attachment-1

Rev. No.	Date	Page	Category	Contents
Rev 1.0	2015/01/30	All	new	First revision.
Rev 1.1	2015/02/28	1,3	Add	Add GNU17V3.0.1 release history.
Rev 1.2	2015/04/03	2,5,6	Add	Add GNU17V3.0.2 release history.
Rev1.3	2015/04/27	2,6	Add	Add GNU17V3.0.3 release history.
Rev1.4	2015/05/27	2,7,8	Add	Add GNU17V3.0.4 release history.
Rev1.5	2015/10/30	2,8	Add	Add GNU17V3.0.5 release history.

AMERICA

EPSON ELECTRONICS AMERICA, INC.

214 Devcon Drive,
San Jose, CA 95112, USA
Phone: +1-800-228-3964 FAX: +1-408-922-0238

EUROPE

EPSON EUROPE ELECTRONICS GmbH

Riesstrasse 15, 80992 Munich,
GERMANY
Phone: +49-89-14005-0 FAX: +49-89-14005-110

ASIA

EPSON (CHINA) CO., LTD.

7F, Jinbao Bldg., No.89 Jinbao St.,
Dongcheng District,
Beijing 100005, CHINA
Phone: +86-10-8522-1199 FAX: +86-10-8522-1125

SHANGHAI BRANCH

7F, Block B, Hi-Tech Bldg., 900 Yishan Road,
Shanghai 200233, CHINA
Phone: +86-21-5423-5577 FAX: +86-21-5423-4677

SHENZHEN BRANCH

12F, Dawning Mansion, Keji South 12th Road,
Hi-Tech Park, Shenzhen 518057, CHINA
Phone: +86-755-2699-3828 FAX: +86-755-2699-3838

EPSON HONG KONG LTD.

Unit 715-723, 7/F Trade Square, 681 Cheung Sha Wan Road,
Kowloon, Hong Kong.
Phone: +852-2585-4600 FAX: +852-2827-4346

EPSON TAIWAN TECHNOLOGY & TRADING LTD.

14F, No. 7, Song Ren Road,
Taipei 110, TAIWAN
Phone: +886-2-8786-6688 FAX: +886-2-8786-6660

EPSON SINGAPORE PTE., LTD.

1 HarbourFront Place,
#03-02 HarbourFront Tower One, Singapore 098633
Phone: +65-6586-5500 FAX: +65-6271-3182

SEIKO EPSON CORP.**KOREA OFFICE**

5F, KLI 63 Bldg., 60 Yoido-dong,
Youngdeungpo-Ku, Seoul 150-763, KOREA
Phone: +82-2-784-6027 FAX: +82-2-767-3677

SEIKO EPSON CORP.**MICRODEVICES OPERATIONS DIVISION****Device Sales & Marketing Department**

421-8, Hino, Hino-shi, Tokyo 191-8501, JAPAN
Phone: +81-42-587-5814 FAX: +81-42-587-5117